

Release Note

Product Name: VS-88UT

Current Version:

Ver.Type	Ver No.	Date
Firmware	01.01.0014	January 2018
Software	–	–
Web	–	–
Hardware	–	–

RN Date: January 2018

Reference: 10515

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-88UT	N/A	N/A	N/A

Technical Notes:

- This is a release note for a new product.

Codependency with Other Products and Software:

- There is no codependency with other products or software.



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com

Release Note History

Product Name: VS-88UT

Current Version:

Ver.Type	Ver No.	Date
Firmware	01.01.0014	January 2018
Software	–	–
Web	–	–
Hardware	–	–

RN Date: January 2018

Reference: 10515

This is a release note for a new product. For a list of new product features see:

<http://www.kramerav.com/manual/VS-88UT>

Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
10843	FW upgrade connection: due to RS-232 baud rate limitations it is recommended to use TCP/UDP rather than RS-232 connection when performing FW upgrade
10853	K-Config and K-Upload can only be used through TCP
10878	UDP port 50000 becomes disabled if user defines another UDP port.
10985	HDBT ports hot plug-in or plug-out may trigger a wrong auto switching
11261	Over 100MB file copy through USB 2.0 could fail with some types of flash drives
11283	WAN port indication LED lights when the port is disconnected
11447	Remote control: Date is not presented on the remote control when defined as a slave device for the unit.
11466	Remote control: Knobs of the remote control do not function when defined as slave device for the unit.
11516	EDID management remote actions, for example through EDID Designer application, may result in a short discontinuity of HDCP encrypted video output.
11773	FW upgrade should be done through Ethernet, not through the Mini-USB connector.



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com

Release Note History

QC ID	Deferred Bug Description
12285	Web page browsing with IE and Safari need manual refresh after performing product Reset
12290	Web page FW upgrade using IE Edge browser may fail. It is recommended to use Chrome and Firefox browsers for the best results.
12319	RC Virtual Device on Web: Device startup option is not supported.
12334	The factory Reset button does not reset the configuration file of the Room Controller card.
12335	HDBT/HDMI selection does not trigger the input as LAST CONNECTED when output is configured in LC auto switching.

Known Limitations (including compatibility limitations):

QC ID	Limitation Description
	None listed.

Preceding Version: N/A



KRAMER ELECTRONICS, Ltd.

E-mail: info@kramerav.com

Web: www.kramerav.com